

# Linco Enterprises

## TEST REPORT

**SCOPE OF WORK**

THE LANDS SPC FLOOR

**REPORT NUMBER**

200311004SHF-002

**TEST DATE(S)**

2020-03-11 - 2020-03-24

**ISSUE DATE**

2020-03-24

**PAGES**


6

**DOCUMENT CONTROL NUMBER**

LFT-APAC-SHF-OP-10k(May 1, 2019)

© 2020 INTERTEK

Intertek Testing Services Shenzhen Ltd. Shanghai Fengxian Branch

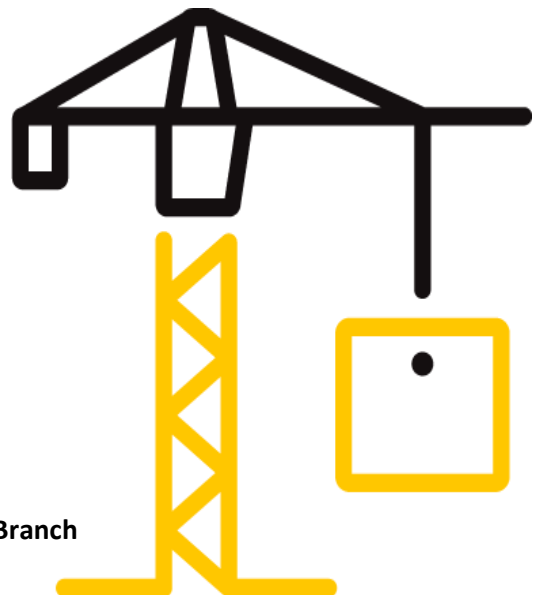

## Test Report

### Statement

- 1.This report is invalid without company's special seal for testing on assigned page.
- 2.This report is invalid without authorized person's signature.
- 3.This report is invalid where any unauthorized modification indicated.
- 4.Don't copy this report in partial (except full copy) without any official approval in written by our company. This report is invalid without re-stamping the special seal for testing in copying report.
- 5.Any holder of this document is advised that this report is for the exclusive use of Intertek's Customer and is provided pursuant to the agreement between Intertek and its Customer. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. This report was made with due care within the limitation of a defined scope of work and on the basis of information, materials and instructions received from the Customer or its nominated third parties. Intertek is under no obligation to refer to or report upon any facts or circumstances which are outside the specific instructions received and accepts no responsibility to any parties whatsoever, following the issue of the report, for any matters arising outside the agreed scope of the works. The tests results are not intended to be a recommendation for any particular course of action. Customer is responsible for acting as it sees fit on the basis of such results.
- 6.Intertek's written consent is required to use Intertek's name or logo on the object, product or service being tested. The observations and test results in this report relate only to the sample under test. This report alone does not indicate that the item, product or service has passed any Intertek certification program.

# Test Report

Issue Date: 2020-03-24 Intertek Report No. 200311004SHF-002  
 Applicant: Linco Enterprises  
 Address: 13626 Monte Vista Ave, Ste B Chino, CA 91710,USA Tel 909-590-5300  
 Attn: Carl cao  
 Test Type : Performance test, samples provided by the applicant.

### Product Information

<b>Product Name</b>	THE LANDS SPC FLOOR		<b>Brand</b>	NexxaCore Engineered Vinyl Flooring
<b>Sample Description</b>	Good Condition		<b>Sample Amount</b>	1 package
			<b>Received Date</b>	2020-03-09
<b>Sample ID</b>	<b>Model</b>		<b>Specification</b>	
S200311004SHF.003~004	20-120-88066-1 Zion		48"X7"X5.0MM(1MM XPE)	

### Test Methods And Standards

<b>Test Standard</b>	CPSC-CH-C1001-09.3
<b>Specification Standard</b>	/
<b>Test Conclusion</b>	The samples were tested according to the above standards, and the results are shown in the following page.

Note:

1.This report relates specifically to the sample(s) that were drawn and provided by the applicant or their nominated third party. The reported result(s) provide no warranty or verification on the sample(s) representing any specific goods and/or shipment and only relate to the sample(s) as received and tested.

### Report Authorized

  
 Name: Flora Fan Title: Reviewer


  
 Name: Milo Liu Title: Project Engineer

# Test Report

Issue Date: 2020-03-24

Intertek Report No. 200311004SHF-002

## Test Items, Method and Results:

Test Item: Phthalate content test

Test Method: With reference to CPSC-CH-C1001-09.3 and by Gas Chromatography-Mass Spectrometry (GC-MS) analysis.

Tested compound	Result (%w/w)	Limit (%w/w) (Max.)
Diethyl hexyl phthalate (DEHP)	ND	0.1
Benzyl butyl phthalate (BBP)	ND	0.1
Diisononyl phthalate (DINP)*	ND	/

Note:

1. Detection limit = 0.01%(w/w)
2. ND = Not detected (less than detection limit)
3. The above limit was quoted from the Consent Judgment No. CIV-05991 settled by superior court of the State of California for the county of Marin , for Vinyl floor mats, floor tiles and floor coverings based on the California Proposition 65.
4. \* = Test was conducted as per client's requirement.
5. Test location: Central Chemical Lab of Intertek Testing Services Ltd., Shanghai  
Address: Block B, Jinling Business Square, No. 801, Yi Shan Road, Shanghai, China

# Test Report

Issue Date: 2020-03-24

Intertek Report No. 200311004SHF-002

## Test Items, Method and Results:

Test Item: Phthalate content test

Test Method: With reference to CPSC-CH-C1001-09.3, by Gas Chromatography-Mass Spectrometry (GC-MS) analysis.

Tested compound	Result (mg/kg)
Di-butyl phthalate (DBP)	ND
Di(2-ethyl hexyl) phthalate (DEHP)	ND
Benzyl butyl phthalate (BBP)	ND
Di-iso-nonyl phthalate (DINP)	ND
Di-n-octyl phthalate (DNOP)	ND
Di-iso-decyl phthalate (DIDP)	ND
Di-n-hexyl phthalate (DnHP/DHEXP)	ND
Di-iso-butyl phthalate (DIBP)	ND
Bis(2-methoxyethyl) phthalate (DMEP)	ND
Di-n-pentyl phthalate (DnPP/DPENP)	ND
1,2-Benzenedicarboxylic acid, di-C7-11-branched and linear alkyl esters (DHNUP)	ND
1,2-Benzenedicarboxylic acid, di-C6-8-branched alkyl esters, C7-rich (DIHP)	ND
Di-cyclohexyl phthalate (DCHP)	ND
Di-ethyl phthalate (DEP)	ND
Di-propyl phthalate (DPrP)	ND

Note:

1. Detection limit = 100mg/kg
2. ND = Not detected (less than the detection limit)
3. Test location: Central Chemical Lab of Intertek Testing Services Ltd., Shanghai  
Address: Block B, Jinling Business Square, No.801, Yi Shan Road, Shanghai, China

## Test Report

Issue Date: 2020-03-24

Intertek Report No. 200311004SHF-002

### Appendix A: Sample Received Photo



### Revision:

NO.	Date	Changes	Author	Reviewer
200311004SHF-002	2020-03-24	First issue	Milo Liu	Flora Fan